



LAND ROVER

LAND ROVER

 Code 

0-9

14TCIE 778

18K16 778

200TDi 782

204PT 778

20T4 778

224DT 780

22 D 786



22D 786

244DT 780

25 6T (BMW) 784

256TM 784

25 K4F 780

 Code 

276DT 786

3.9V8EFI 788-790

300TDi 784

306DT 786

30DDTX 786

35 D 788

36 D 788

37 D 790



38 D 790

4.2V8EFI 792

40 D 790

42 D 788

46 D 792

 Code 

D

DW12BTED4 780

I

i6 786



K

KV6 780

M

M 47 778

M 47 R 778

 Code 

M62 B44 792

MGRV8 790

S


SEV8 788

T

Td5 782

V

V06VEI 788

 Code 

 Code 

 Code 

 Code 

LAND ROVER						
Ltr.						
1,8 18K16	86-88 kW (117-120 PS)	FREELANDER 16V	02/98-10/06	02-34835-04 ⑫ 08-36343-01 ⑬	61-34835-20 LVB500190 MLS 	14-32100-01 WAN2293L (10x)
2,0 M 47 M 47 R	80-85 kW (109-116 PS)	FREELANDER Td4	11/01→	02-40452-01 ⑫ 08-36219-01 ⑬ LVQ101240L	61-36455-00 LVB101820L 1,45 mm 1 MLS 61-36455-10 LVB101830L 1,55 mm 2 MLS 61-36455-20 LVB000100L 1,65 mm 3 MLS 	
2,0 14TCIE	72 kW (98 PS)	FREELANDER DI	02/98-11/00	01-35496-01 ⑫ ⑬ 02-35496-02 ⑫ 	61-35360-00 LVB100910 85,5 Ø 1,05 mm 1 61-35360-10 LVB100920 85,5 Ø 1,2 mm 2 61-35360-20 LVB100930 85,5 Ø 1,35 mm 3 	14-32007-01 LDG100040L (10x)
2,0 20T4	99 kW (135 PS)	DISCOVERY 16V	09/93-10/98	02-35365-01 08-35507-01 ⑭ STC848	61-35365-00 LVB101000 87 Ø MLS 	
2,0 204PT [NEW]	177 kW (241 PS)	FREELANDER 2 RANGE ROVER EVOQUE	06/11→	01-36290-02 ⑫ ⑬ 02-36290-02 ⑫	61-36290-00 LR024975 MLS 	14-32207-01 LR025253 (10x)

⑦ Dichtung Ansaug-/Abgaskrümmer / intake/exhaust manifold gasket / joint collecteur d'admission/d'échappement / junta para múltiple de admisión/de escape / guarnizione collettore di aspirazione/di scarico / прокладка всасывающего/выпускного колена
⑭ ohne Wellendichtring-Kurbelwelle / without crankshaft oil seal / sans bague d'étanchéité - vilebrequin / sin retén cigüeñal / senza paraolio albero motore / без уплотнительного кольца коленчатого вала



71-34837-00 LVP100630L 	12-34836-01 LUB100350L (16x)	71-34838-00 LKJ101110L 	71-34839-00 LKG100551 		81-34842-00 N ← 30x40x7 A SL RD FPM 81-38342-00 N → LUC100220L 30x40x7 A SL LD FPM
71-40452-00 LVP100620L 	12-35172-01 LGP100310L	71-33109-10 4x 8510218 	71-33027-00 2x LR020102 	71-36219-00 LVF100420L 	81-37002-00 K ← LUF100530L 55x68x8 AB RD PTFE 81-20745-50 K → LUF100540L 90x110x12 AB SL LD PTFE ACM
71-35496-00 LVP100400 	12-35493-01 LJQ100680L (8x)		71-37037-00 WCM100480 	71-35495-00 ERR7029 	81-35497-00 K → WZX1915 35x45x7 A SL RD FPM 81-90028-00 K → LUF100420 LD 81-15999-30 N
71-35492-00 ⑦ LKJ100790 					
71-35503-00 ES GUG705026VC 	12-37052-01 LUB10009 (16x) → 20T101828 12-37053-01 LJQ100560 (16x) → 20T101829→ 70-37052-00 16x LUB10009 → 20T101828 70-37053-00 16x LJQ100560 → 20T101829→	71-35499-00 LKJ10027 	71-35501-00 LKG100290L 	71-35502-00 LVF10005 	81-35506-00 K ← ADU8891 35x47x7 A SL RD FPM 81-35498-00 K → LUL10007L
71-35504-00 AS LVP100170 					
15-42391-01 LR025664 	12-35546-01 LR025006 (8x) +LR025018 (8x)	15-40257-01 LR024991 (4x) 	71-40262-00 LR025852 	70-31414-10 	81-42449-00 K ← LR043291 37x50x6 A SL RD FPM 81-90012-00 K → LR041995 PTFE

AS Auslaßseite / exhaust side / côté échappement / lado de escape / lato scarico / сторона выпуска
ES Einlaßseite / intake side / côté admission / lado de admisión / lato aspirazione / сторона впуска



LAND ROVER						
Ltr.						
2,2 DW12BTD4 224DT [NEW]	110-140 kW (150-190 PS) FREELANDER 2 RANGE ROVER EVOQUE	10/06→		02-39244-03 ¹² 08-39246-01 ¹³	61-35805-00 LR017303 85,9 Ø 1,25 mm MLS 1 61-35805-10 LR017304 85,9 Ø 1,3 mm MLS 2 61-35805-20 LR017305 85,9 Ø 1,35 mm MLS 3 61-35805-30 LR017307 85,9 Ø 1,4 mm MLS 4 	14-35774-01 LR001222 (10x)
2,4 244DT [NEW]	90 kW (122 PS) DEFENDER TD	05/07→		01-33758-01 ¹² ¹³ 02-33758-05 ¹² 	61-35420-00 LR004418 91 Ø 1,1 mm MLS 1 61-35420-10 LR004419 91 Ø 1,15 mm MLS 2 61-35420-20 LR004420 91 Ø 1,2 mm MLS 3 	14-32204-01 LR004369 (10x) +LR004370 (8x)
2,5 KV6 25 K4F	129-130 kW (175-177 PS) FREELANDER V6	11/00→		02-35355-02 ¹² 08-35408-01 ¹³ ³⁵	61-35355-00 2x LVB101630L 81 Ø MLS 	14-55070-01 2x

³⁵ enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene retén integrado / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала
 H hinten / rear / arrière / posterior / posteriore / сзади



15-38554-01 LR009411 +LR009412 (2x) +LR002834 	12-38539-01 LR001242 (16x) 70-38539-00 LR001242 16x	11-38553-01 LR005364 	71-42393-00 LR022333 	70-31414-10 	81-36557-00 K ← LR000673 42x62x7 A SL RD PTFE 81-36556-00 K → LR000674 90x110x7 A SL LD PTFE 81-34144-00 N LR000659 27x47x7 A SL RD FPM
71-33758-00 LR004440 	12-35549-01 LR005901 (16x) 70-35549-00 LR005901 16x	71-35539-00 8x LR018370 	71-33894-00 LR004393 	15-35536-01 LR006957 70-31414-10 	81-90014-00 K ← LR029318 PTFE 81-90013-00 K → LR020609 PTFE
71-39082-00 2x LVP100470L 	12-35406-01 LUB100350L (24x)	71-39081-00 2x LKJ100992L 	71-35403-00 2x LKG100290L 	70-31414-10 	81-38343-00 K ← LQX100070L 32x45x6,8 A RD MVQ 81-90049-00 K → LUF100300L 81-34842-00 N V 2x 30x40x7 A SL RD FPM 81-38342-00 N H 4x LUC100220L 30x40x7 A SL LD FPM

V vorne / front / avant / delante / anteriore / спереди

































LAND ROVER						
Ltr.						
2,5 Td5	102 kW (139 PS) DISCOVERY Td5	01/99-06/04	<p>02-36824-01 ⑫ → 1A736339</p> <p></p> <p>02-36826-01 ⑫ → 2A736340</p> <p></p> <p>08-36674-01 ⑬</p>	<p>61-36300-00 LVB000240 86 Ø 1,2 mm 2 □ MLS</p> <p>61-36300-10 LVB000250 86 Ø 1,27 mm 1 □ MLS</p> <p>61-36300-20 LVB000260 86 Ø 1,35 mm 3 □ MLS</p>	14-32008-01 ERR5384 (12x)	
2,5 200TDi	83 kW (113 PS) DEFENDER TDI DISCOVERY TDI	10/89→	<p>02-35518-01 ⑫ STC362</p> <p></p> <p>08-35521-01 ⑬ STC363</p> <p></p>	<p>61-34465-00 ERR5261 92 Ø 1,42 mm 1 □</p> <p>61-34465-10 ERR5262 92 Ø 1,52 mm 2 □</p> <p>61-34465-20 ERR5263 92 Ø 1,62 mm 3 □</p> <p>61-34465-30 ERR7154 92 Ø 1,71 mm 0</p> <p>61-36655-00 LVB500200 92 Ø 1,3 mm MLS</p> <p>61-36655-10 LVB500210 92 Ø 1,4 mm MLS</p> <p>61-36655-20 LVB500220 92 Ø 1,5 mm MLS</p> <p>61-36655-30 LVB500230 92 Ø 1,6 mm MLS</p>	14-32256-01 ETC8808 (4x) +ETC8809 (10x) +ETC8810 (4x)	

<p>71-36824-00 ERR7094 → 1A736339</p> <p>71-36826-00 LVP000020 → 2A736340</p>	<p>12-37101-02 LJQ100940 (10x) 70-37101-00 LJQ100940</p> <p>10x</p>	<p>71-36672-00 LKJ000010</p>	<p>71-36673-00 LKG100470</p> <p>71-38291-00 ⚠ ESR3737</p>	<p>71-36674-00 LVF500040</p>	<p>81-36671-00 K ← ERR5992 50x65x8 AB SL RD FPM 81-90028-00 K → LUF100420 LD</p>
<p>71-35518-00 ERR2393</p>	12-26545-01	<p>71-35517-00 ⑦ ERR1208</p>	<p>70-31414-10</p>	<p>81-35519-00 K ← 516028 48,6x63,65 RD 81-35521-00 K → ERR2532 100x120x12 81-15999-30 N</p>	

⑦ Dichtung Ansaug-/Abgaskrümmer / intake/exhaust manifold gasket / joint collecteur d'admission/d'échappement / junta para múltiple de admisión/de escape / guarnizione collettore di aspirazione/di scarico / прокладка всасывающего/выпускного колена



LAND ROVER			
Ltr. 			
2,5 25 6T (BMW) 256TM	100 kW (136 PS) RANGE ROVER D	07/94-03/02	<p>02-31296-02 ¹² STC2033</p>  <p>08-31298-02 ¹³ STC2012</p>
			<p>61-31335-10 STC2031 80 Ø 1,87 mm 3 </p> 
			<p>14-32004-01 STC2023</p> 
2,5 300TDi	83 kW (113 PS) DEFENDER TDI DISCOVERY TDI	10/89-12/98	<p>02-35511-01 ¹² STC2802</p>  <p>08-35513-01 ^{13 38} STC2801</p> 
			<p>61-34465-00 ERR5261 92 Ø 1,42 mm 1 </p> <p>61-34465-10 ERR5262 92 Ø 1,52 mm 2 </p> <p>61-34465-20 ERR5263 92 Ø 1,62 mm 3 </p> <p>61-34465-30 ERR7154 92 Ø 1,71 mm 0</p> 
			<p>14-32259-01 ERR1939 (10x) +ETC8808 (4x) +ETC8810 (4x)</p> 

					
<p>71-31296-00 STC4177</p> 	<p>12-31306-08 LDY000060 (12x) 70-31306-00 LDY000060</p> <p>12x</p>	<p>71-29398-10 STC2203</p>  <p>6x</p>	<p>71-29396-00 STC3697</p>  <p>4x</p> <p>71-29399-00 STC3696</p> 	<p>71-31298-00 STC2036</p> 	<p>81-17404-50 K ← LUF00010 48x65x10 AB SL RD FPM 81-20745-40 K → STC4283 90x110x12 A SL LD FPM</p>
<p>71-35511-00 ERR2409</p> 	<p>12-26545-01</p>	<p>71-35509-00 ⁷ ERR3785</p> 	<p>70-31414-10</p> 	<p>81-35512-00 K ← 47x62 RD 81-90029-00 K →  LUF100430 81-35514-00 N 40x56x7</p>	

⁷ Dichtung Ansaug-/Abgaskrümmer / intake/exhaust manifold gasket / joint collecteur d'admission/d'échappement / junta para múltiple de admisión/de escape / guarnizione collettore di aspirazione/di scarico / прокладка всасывающего/выпускного колена

³⁸ ohne Wedi Getriebes / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / sin retén en el lado de la transmisión / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



LAND ROVER						
Ltr.						
2,7 276DT [NEW]	140 kW (190 PS) DISCOVERY TD RANGE ROVER TDVM	07/04→				
			02-38558-03 ⑫ 08-38527-03 ⑬ ⑮	61-34875-10 2x LR009719 82,5 Ø 1,17 mm MLS 61-34875-20 2x LR009721 82,5 Ø 1,22 mm MLS 61-34875-30 2x LR009722 82,5 Ø 1,27 mm MLS 61-34875-40 2x LR009723 82,5 Ø 1,32 mm MLS 	14-32334-01 2x 1331316 (8x) 	
3,0 30DDTX 306DT [NEW]	155-200 kW (211-272 PS) DISCOVERY SDV6 DISCOVERY TD RANGE ROVER SPORT TD RANGE ROVER TD	09/09→	02-38558-02 ⑫ 08-38527-02 ⑬	61-36610-00 2x LR013063 85 Ø 1,17 mm MLS 61-36610-10 2x LR013066 85 Ø 1,22 mm MLS 61-36610-20 2x LR013070 85 Ø 1,27 mm MLS 61-36610-30 2x LR013073 85 Ø 1,32 mm MLS 	14-32344-01 2x 1331316 (8x) 	
3,2 i6	170 kW (231 PS)		02-37620-01 ⑫ 08-39587-01 ⑬	61-37620-00 LR006664 84,85 Ø MLS 	14-32306-01 LR002553 (14x) 	
3,5 22 D 22D	107-113 kW (146-154 PS) DISCOVERY (SALLJG) RANGE ROVER	01/87-06/94	02-35370-01 ⑫ STC1566 08-35523-01 ⑬ STC1639	61-35370-00 2x GEG340 92,2 Ø 		

⑮ enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene retén integrado / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



71-38558-00 2x LR029132 	12-38546-01 1311285 (24x) 70-38546-00 24x 1311285		71-34888-00 2x 1336543 	71-38527-00 LR005994 71-41252-00 1365260 	81-34316-00 K ← 1102415 35x50x7 A SL RD PTFE ACM 81-90050-00 K → LR036542 81-38536-00 N 3x 1311318 26x45x8 A SL WD FPM
71-38558-00 2x LR029132 	12-38546-01 1311285 (24x) 70-38546-00 24x 1311285		71-34888-00 2x 1336543 	71-38527-00 LR005994 	81-34316-00 K ← 1102415 35x50x7 A SL RD PTFE ACM 81-90050-00 K → LR036542 81-38536-00 N 3x 1311318 26x45x8 A SL WD FPM
15-39299-01 LR001808 (6x) +LR001978 	12-31306-05 LR002556 (24x) 70-31306-00 24x LDY000060	71-39303-00 6x LR001454 	71-39332-00 2x LR001455 	70-31414-10 	81-39311-00 K ← 19x38,5x8 A SL RD PTFE 81-39337-00 K → LR001418 98x118x10 A SL LD PTFE ACM
71-36379-00 2x GEG436 Kork 		71-35528-00 LKJ500020 	71-35527-00 ERC3605 	71-35531-00 602087 Kork 	81-35519-00 K ← 516028 48,6x63,65 RD 81-35523-00 K → 611409 82x98,5 LD



LAND ROVER						
Ltr.						
3,9 SEV8 V06VEi 3.9V8EFI 42 D	136-140 kW (185-190 PS)	RANGE ROVER	07/94→	02-35380-01 ⑫ STC2822 08-35523-02 ⑬ STC2823	61-35380-00 2x LVB500030 95,6 Ø 	
3,9 35 D	134 kW (182 PS)	DISCOVERY V8	09/93-10/98	02-35375-01 ⑫ STC1641 → 35D08927B 02-35380-01 ⑫ STC2822 → 35D08928B→ 08-35523-01 ⑬ STC1639 → 35D08927B 08-35523-02 ⑬ STC2823 → 35D08928B→	61-35375-00 2x ETC7819 91,5 Ø MLS → 35D08927B 61-35380-00 2x LVB500030 95,6 Ø → 35D08928B→ 	
3,9 35 D	134 kW (182 PS)	RANGE ROVER	11/88-07/94	02-35375-01 ⑫ STC1641 → 35D08927B 02-35380-01 ⑫ STC2822 → 35D08928B→ 08-35523-01 ⑬ STC1639 → 35D08927B 08-35523-02 ⑬ STC2823 → 35D08928B→	61-35375-00 2x ETC7819 91,5 Ø MLS → 35D08927B 61-35380-00 2x LVB500030 95,6 Ø → 35D08928B→ 	
3,9 36 D	134 kW (182 PS)	DISCOVERY V8	09/93-10/98	02-35375-01 ⑫ STC1641 → 36D25154B 02-35380-01 ⑫ STC2822 → 36D25155B→ 08-35523-01 ⑬ STC1639 → 36D25154B 08-35523-02 ⑬ STC2823 → 36D25155B→	61-35375-00 2x ETC7819 91,5 Ø MLS → 36D25154B 61-35380-00 2x LVB500030 95,6 Ø → 36D25155B→ 	
3,9 36 D	134 kW (182 PS)	RANGE ROVER	11/88-07/94	02-35375-01 ⑫ STC1641 → 36D25154B 02-35380-01 ⑫ STC2822 → 36D25155B→ 08-35523-01 ⑬ STC1639 → 36D25154B 08-35523-02 ⑬ STC2823 → 36D25155B→	61-35375-00 2x ETC7819 91,5 Ø MLS → 36D25154B 61-35380-00 2x LVB500030 95,6 Ø → 36D25155B→ 	



71-35524-10 2x LVC100260 Gummi 	12-36903-01 ERR1782 (16x) 70-36903-00 16x ERR1782 	71-35528-00 LKJ500020 	71-35532-00 4x ERR6733 	71-35531-00 602087 Kork 	81-35519-00 K ← 516028 48,6x63,65 RD 81-35523-00 K → 611409 82x98,5 LD
71-35524-10 2x LVC100260 Gummi 		71-35528-00 LKJ500020 	71-35527-00 8x ERC3605 → 35D08927B 71-35532-00 4x ERR6733 → 35D08928B→ 	71-35531-00 602087 Kork 	81-35519-00 K ← 516028 48,6x63,65 RD 81-35523-00 K → 611409 82x98,5 LD
71-35524-10 2x LVC100260 Gummi 	12-36903-01 ERR1782 (16x) → 35D08928B→ 70-36903-00 16x ERR1782 → 35D08928B→	71-35528-00 LKJ500020 	71-35527-00 8x ERC3605 → 35D08927B 71-35532-00 4x ERR6733 → 35D08928B→ 	71-35531-00 602087 Kork 	81-35519-00 K ← 516028 48,6x63,65 RD 81-35523-00 K → 611409 82x98,5 LD
71-35524-10 2x LVC100260 Gummi 		71-35528-00 LKJ500020 	71-35527-00 8x ERC3605 → 36D25154B 71-35532-00 4x ERR6733 → 36D25155B→ 	71-35531-00 602087 Kork 	81-35519-00 K ← 516028 48,6x63,65 RD 81-35523-00 K → 611409 82x98,5 LD
71-35524-10 2x LVC100260 Gummi 	12-36903-01 ERR1782 (16x) → 36D25155B→ 70-36903-00 16x ERR1782 → 36D25155B→	71-35528-00 LKJ500020 	71-35527-00 8x ERC3605 → 36D25154B 71-35532-00 4x ERR6733 → 36D25155B→ 	71-35531-00 602087 Kork 	81-35519-00 K ← 516028 48,6x63,65 RD 81-35523-00 K → 611409 82x98,5 LD
















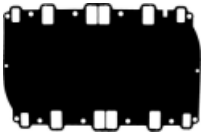












LAND ROVER						
Ltr.						
3,9 37 D	127 kW (173 PS) RANGE ROVER	11/88-07/94	02-35375-01 ⑫ STC1641 → 37D02931B 02-35380-01 ⑫ STC2822 → 37D02932B→ 08-35523-01 ⑬ STC1639 → 37D02931B 08-35523-02 ⑬ STC2823 → 37D02932B→	61-35375-00 2x ETC7819 91,5 Ø MLS → 37D02931B 61-35380-00 2x LVB500030 95,6 Ø → 37D02932B→ 		
3,9 38 D	127 kW (173 PS) RANGE ROVER	11/88-07/94	02-35375-01 ⑫ STC1641 → 38D27237B 02-35380-01 ⑫ STC2822 → 38D27238B→ 08-35523-01 ⑬ STC1639 → 38D27237B 08-35523-02 ⑬ STC2823 → 38D27238B→	61-35375-00 2x ETC7819 91,5 Ø MLS → 38D27237B 61-35380-00 2x LVB500030 95,6 Ø → 38D27238B→ 		
3,9 3.9V8EFI	127 kW (173 PS) RANGE ROVER	11/88-07/94	02-35375-01 ⑫ STC1641 → 12/93 02-35380-01 ⑫ STC2822 → 01/94→ 08-35523-02 ⑬ STC2823 → 01/94→ 08-35523-01 ⑬ STC1639	61-35375-00 2x ETC7819 91,5 Ø MLS → 12/93 61-35380-00 2x LVB500030 95,6 Ø → 01/94→ 		
4,0 MGRV8	136 kW (185 PS) DISCOVERY V8	11/98-06/04	02-35380-01 ⑫ STC2822 08-35523-02 ⑬ STC2823	61-35380-00 2x LVB500030 95,6 Ø 		
4,3 40 D	149 kW (203 PS) RANGE ROVER	09/92-07/94	02-35380-01 ⑫ STC2822 08-35523-02 ⑬ STC2823	61-35380-00 2x LVB500030 95,6 Ø 		



71-35524-10 2x LVC100260 Gummi 	12-36903-01 ERR1782 (16x) → 37D02932B→ 70-36903-00 16x ERR1782 → 37D02932B→	71-35528-00 LKJ500020 	71-35527-00 8x ERC3605 → 37D02931B 71-35532-00 4x ERR6733 → 37D02932B→ 	71-35531-00 602087 Kork 	81-35519-00 K ← 516028 48,6x63,65 RD 81-35523-00 K → 611409 82x98,5 LD
71-35524-10 2x LVC100260 Gummi 	12-36903-01 ERR1782 (16x) → 38D37238B→ 70-36903-00 16x ERR1782 → 38D37238B→	71-35528-00 LKJ500020 	71-35527-00 8x ERC3605 → 38D27237B 71-35532-00 4x ERR6733 → 38D27238B→ 	71-35531-00 602087 Kork 	81-35519-00 K ← 516028 48,6x63,65 RD 81-35523-00 K → 611409 82x98,5 LD
71-35524-10 2x LVC100260 Gummi 	12-36903-01 ERR1782 (16x) 70-36903-00 16x ERR1782	71-35528-00 LKJ500020 	71-35527-00 8x ERC3605 → 12/93 71-35532-00 4x ERR6733 → 01/94→ 	71-35531-00 602087 Kork 	81-35519-00 K ← 516028 48,6x63,65 RD 81-35523-00 K → 611409 82x98,5 LD
71-35524-10 2x LVC100260 Gummi 	12-36903-01 ERR1782 (16x) 70-36903-00 16x ERR1782	71-35528-00 LKJ500020 	71-35532-00 4x ERR6733 	71-35531-00 602087 Kork 71-39086-00 LVF100400 Gummi 	81-35519-00 K ← 516028 48,6x63,65 RD 81-35523-00 K → 611409 82x98,5 LD
71-35524-10 2x LVC100260 Gummi 		71-35528-00 LKJ500020 	71-35532-00 4x ERR6733 	71-35531-00 602087 Kork 	81-35519-00 K ← 516028 48,6x63,65 RD 81-35523-00 K → 611409 82x98,5 LD

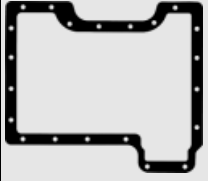

LAND ROVER						
Ltr. 						
4,3 4.2V8EFI	149 kW (203 PS) RANGE ROVER	09/92-07/94	02-35380-01 ⁽¹²⁾ STC2822 08-35523-02 ⁽¹³⁾ STC2823	61-35380-00 2x LVB500030 95,6 Ø 		
4,4 M62 B44	210 kW (286 PS) RANGE ROVER		02-33396-01 ⁽¹²⁾ LVQ000020  08-31828-03 ⁽¹³⁾	61-31370-00 L LVB000360 93 Ø 1,74 mm MLS Zyl. 1 - 4 61-31370-10 L LVB000370 93 Ø 2,07 mm MLS Zyl. 1 - 4  61-31375-00 R LVB000340 93 Ø 1,74 mm MLS Zyl. 5 - 8 61-31375-10 R LVB000350 93 Ø 2,07 mm MLS Zyl. 5 - 8 	14-32005-01 2x LYG000200 	
4,6 46 D	165 kW (224 PS) RANGE ROVER	07/94-03/02	02-35380-01 ⁽¹²⁾ STC2822 08-35523-02 ⁽¹³⁾ STC2823	61-35380-00 2x LVB500030 95,6 Ø 		

71-35524-10 2x LVC100260 Gummi 	12-36903-01 ERR1782 (16x) 70-36903-00 16x ERR1782	71-35528-00 LKJ500020 	71-35532-00 4x ERR6733 	71-35531-00 4x 602087 Kork 	81-35519-00 K ← 516028 48,6x63,65 RD 81-35523-00 K → 611409 82x98,5 LD
15-33396-01 L LR003813 +LVP000030 Zyl. 1 - 4 	12-31306-12 2x LDY000060 (16x) 70-31306-00 32x LDY000060	71-31853-00 4x LKJ000040 	71-31834-10 3x LKG000100  71-31836-10 LKG000100 	71-31828-00 LVF000030  71-40369-00 ⁽¹¹⁾ LVF000040 	81-17404-50 K ← LUF000010 48x65x10 AB SL RD FPM 81-27373-00 K → LUF000020 100x125x13 A SL LD FPM
71-35524-10 2x LVC100260 Gummi 		71-35528-00 LKJ500020 	71-35532-00 4x ERR6733 	71-35531-00 4x 602087 Kork 	81-35519-00 K ← 516028 48,6x63,65 RD 81-35523-00 K → 611409 82x98,5 LD

⁽¹¹⁾ Dichtung Ölsumpf / oil pan gasket / joint de carter d'huile / junta carter / guarnizione coppa dell'olio / прокладка поддона картера

